


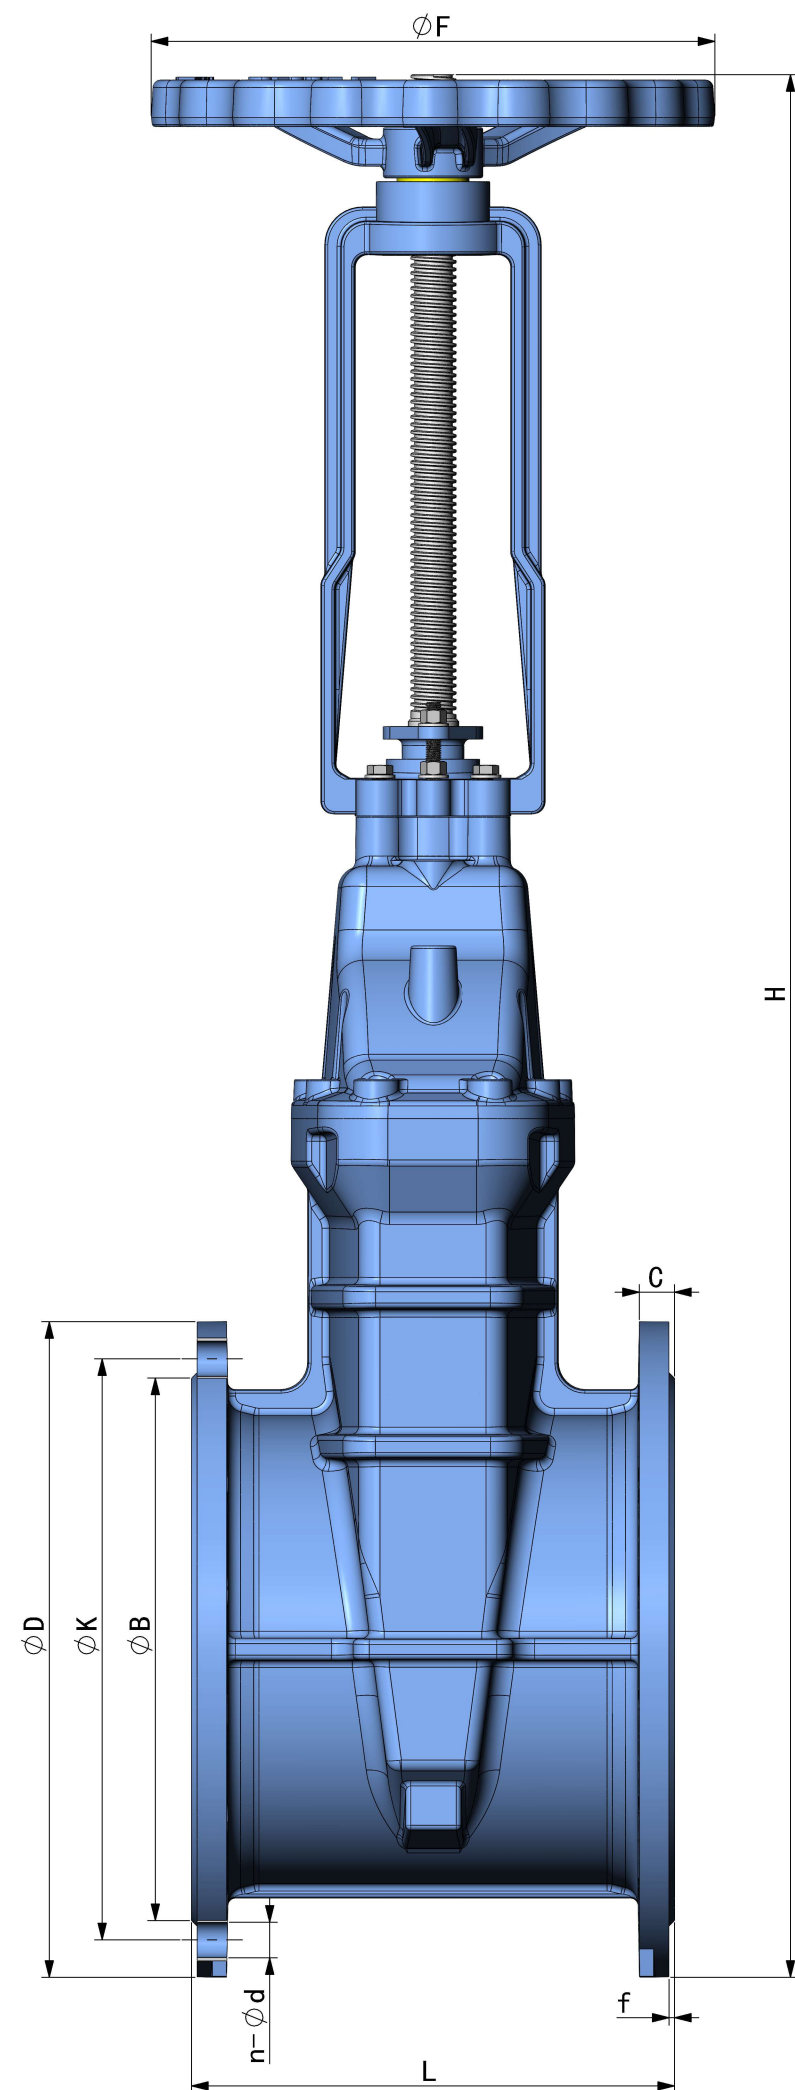

DN (mm)	L		H	$\varnothing B$		$\varnothing D$		$\varnothing K$		n- $\varnothing d$		C		f	$\varnothing F$
	BS	F4		PN10	PN16	PN10	PN16	PN10	PN16	PN10	PN16	PN10	PN16		
50	178	150	360	99		165		125		4- $\varnothing 19$		19		3	180
65	190	170	398	118		185		145		4- $\varnothing 19$		19		3	180
80	203	180	445	132		200		160		8- $\varnothing 19$		19		3	180
100	229	190	565	156		220		180		8- $\varnothing 19$		19		3	250
125	254	200	615	184		250		210		8- $\varnothing 19$		19		3	250
150	267	210	723	211		285		240		8- $\varnothing 23$		19		3	300
200	292	230	877	266		340		295		8- $\varnothing 23$	12- $\varnothing 23$	20		3	330
250	330	250	1080	319		395	405	350	355	12- $\varnothing 23$	12- $\varnothing 28$	22		3	380
300	356	270	1239	370		445	460	400	410	12- $\varnothing 23$	12- $\varnothing 28$	24.5		4	380
350	381	290	1508	429		505	520	460	470	16- $\varnothing 23$	16- $\varnothing 28$	24.5	26.5	4	480
400	406	310	1780	480		565	580	515	525	16- $\varnothing 28$	16- $\varnothing 31$	24.5	28	4	480
450	432	330	2030	530	548	615	640	565	585	20- $\varnothing 28$	20- $\varnothing 31$	25.5	30	4	600
500	457	350	2310	582	609	670	715	620	650	20- $\varnothing 28$	20- $\varnothing 34$	26.5	31.5	4	600
600	508	390	2600	682	720	780	840	725	770	20- $\varnothing 31$	20- $\varnothing 37$	30	36	5	600